

PSA030 Installation Instructions



1. Owner's Manual

Available online: https://wkfluidhandling.com/manuals/

The Installation Instructions provided in this document are available in the PSA030 Owner's Manual, version 2.0.0, published 8/26/2016.





2. Installation

2.1 Precautions

Handling

Do NOT lift pump by shuttle valve assembly nor air tubing.

Installation Orientation

PSA030 pumps must be installed in an upright position. The check valves are actuated by gravity and/or flow, and they will not seat if the pump is not upright.

Timer Mode

PSA030 pumps require an end of stroke detection mechanism (pressure switch) to prevent over stroking in timer mode. Operating a PSA030 in timer mode without stroke detection will void the pump warranty.

Required Air Flow (Shuttle Valve)

PSA030 pumps require 1/4 in minimum orifice with unrestricted air flow.

Required Air Flow (Solenoid Valve)

PSA030 pumps require a 0.75 Cv solenoid. Using a reduced Cv will reduce flow rates. Using a valve with more than 20% greater Cv will change operating parameters, reduce pump life and void the warranty.

Under Supply of Air

PSA030 pumps operate erratically or stall when air supply is insufficient. Ensure use of air supply pressures higher than averaged air consumption lines in performance charts. Air supply lines and fittings must meet minimal inner diameter requirements shown in the installation instructions.

Air Supply Pressure

Operating PSA030 pumps ~35% below max air pressure may significantly extend pump life. PSA030 pumps require 20 psi minimum air pressure. Operation above 7 bar (100 psi) may damage the pump and void the warranty.

Suction Lift

PSA030 pumps have an initial suction lift capacity of 3 ft. For best results minimize suction lift.

Liquid Inlet/Outlet Connections

PSA030 liquid ports are not NPT nor any other standard. Use of connectors other than those supplied by White Knight will damage the pump and void the warranty.

Liquid Line Restriction

PSA030 pumps may be controlled by closing liquid outlet lines. However, restricting liquid supply lines increases wear and should be avoided. Do NOT pump against a closed liquid inlet. It will damage the pump and void the warranty.

Running Dry

PSA030 pumps use the pumped liquid to lubricate their shafts. The pumps will cycle faster and wear more than normal when run dry, which may cause damage and loss of self-prime abilities. Standard models should not be run dry after startup and are not warrantied under dry run conditions. Dry-run capable PSASD030 models may run dry for short periods. Warranty of dry-run models is one-year. Extended warranties are available.

Pulse Dampener with Shuttle Valve

Air supply pressure to PSA030 pumps should be at least ten psi higher than the liquid line pressure when using a pulsation dampener. Failure to do so may cause erratic operation.

Cross Contamination

PSA030 pumps use porous material that may retain chemicals. Take precautions to avoid cross contamination.





2.2 Warnings

Pressurized Material



Pumps in use contain pressurized materials. Eliminate liquid and air pressure via shut off valves before pump is detached or removed from the system.

High Temperature



Heat may transfer to exterior surfaces when pumps operate with high temperature fluids. Avoid direct contact with the pump when high temperature fluids are present.

Hazardous Chemical



Use appropriate personal protective equipment when handling pump. Reference Material Safety Data Sheet (MSDS) for information specific to your chemicals.

Loud Noise



Pump exhaust air contributes to work area noise levels. Only operate pumps with approved muffler media, and use ear protection in noisy conditions.

2.3 Advantages

Head Pressure / Dead-Head

PSA030 pumps can be controlled by adjusting their liquid outlet pressures and can be installed with head pressures up to dead-head (e.g. equal liquid and air pressures) with no damage to the pump.

Thermal Cycling

PSA030 pumps require no maintenance when operated within their performance range, even in thermal cycling applications.

2.4 Environment & System

Oversized Inlet Line

Pumps operate optimally with liquid inlet lines larger than the liquid outlet lines. This reduces strain on the bellows and may reduce pulsation in the pump outlet.

Clean Supply Air (CDA)

PSA030 pumps require use of Class 2 air for particles and moisture per ISO 8573-1. Use 10 micron filter; maintain -40°C dew point. A point-of-use filter is recommended during first six months of operation in new fabs/systems due to high risks of debris that can damage pumps and void warranty.

Flammable Solvents

PSA030 pumps are not constructed from conductive materials. System that pump flammable solvents should be properly grounded to avoid ignition by static charge. A River's Edge test of isolative pumps with flammable liquids indicated that liquids must be grounded and other procedures should be followed. Copy of test available.

Pumping Liquids Near Boiling Point

Minimizing suction lift reduces pulsation and the potential for boiling or outgassing of liquid in the inlet of the pump. Although reciprocating pumps can pull suction lift, pump performance and life increase when suction lift is minimized or eliminated.

Abrasive Slurry

Pumping abrasive slurry shortens the life of any pump. PSA030 pumps are warrantied when used in abrasive applications. However, wear of components will be accelerated. Normal wear is not a condition covered by warranty.

Environmental Temperature

PSA030 pumps are rated to withstand environmental temperatures up to 50°C.





2.5 Installation Instructions

WHITE KNIGH



Move lever to up position.



engineer approved"

Slide base plate forward or pump body backward.



Lift pump off of base plate.





Pull-back dismount is standard. See steps 4.1-4.3 for forward dismount.

Screw base plate to surface with 3/8 in or 10 mm socket head cap screws into predrilled holes.



Set pump on base knobs: slide it forward. Set lever to down position.



6. Attach fittings to pump. Tighten to 30 inch-lbs.



Attach tubes and fittings per manufacturer instructions. Use backer wrench to hold fitting in place at pump.



Affix supply air via 1/4 in FNPT port on shuttle valve. Air line must be 3/16 in minimum orifice.

Push-Forward Dismount Configuration Setup

Replace step 5 with steps 4.1-4.3 to re-configure the base plate to push-forward dismount configuration.



Move knobs to opposite sides.



Set pump on base knobs; slide it backward.



Move lever down to locked position.

Install with Rigid Base Plate



Remove L bracket. Set lever in neutral (up) position.



Slide pump forward; lift it off base plate.



Fix base plate to work station. See step 4 above.



Return pump to base plate.



Move lock lever to down position. Reattach L bracket. Tighten hand tight.

Liquid Inlet/Outlet

Liquid ports are not NPT nor any other standard. Use of connectors other than those supplied by White Knight will damage the pump.





3. Control & Monitoring

Programmable Control

White Knight CPT-1 controllers monitor and adjust run mode, flow rate, leak detection and other pump operations.



Single Sensor Design

PSA030 pumps can use only a single fiber optic sensor at a time. The probe may be installed in the "F" port on either side of the pump. White Knight offers PFA, PFH, and PFU pumps for dual fiber optic use.

Standard Models and Main Unit Sub-Units NPN 12-30V dc 10-30V dc Standard Models Connection From Main 12-30V dc Bussable Power Models Unit Bus Load 150 mA max load 1 Remote Teach Wire Key PNP Remote Teach 1 = Brown 12-30V dc Connection From Main 2 = White 3 = Blue Load Unit Bus QD hookup is functionally identical 4 = Black (Pink wire not used) 5 = Gray ŧ. 10.5 ± 0.2 mm (typ.) 14.5 mm MA (0.57")(0.41") TRANSFERING 7.6 mm æ 35.9 mm 0.30" ⊳ œ (1.41") **_111** α \triangleleft tœ 9.8 mm Mounting Bracket \overline{C} (0.39") (included with some models) 61.3 mm (2.42") 68.1 mm

3.1 Fiber Optic Stroke Detection Installation

 


Remove stroke detect probe from fiber optic assembly.


Fiber Optic Sensors Fiber optic sensors melt if

used at >130°C (266°F), resulting in leak or end of

stroke detection failure.



 Replace NPT plug in "F" port with stroke detect probe. Hand-tighten. 3.



gripper until snug

and hand tighten

female gripper nut.

against probe

Insert the fiber optic cable until it seats at the bottom of the probe.

(2.68")

Open the top and slide the front face of the D10 up. Press the fiber optic ends into the holes on its front. Slide the face down to lock cables in place.



D10 Amplifier Electrical Hookups & Dimensions

White Knight recommends Expert[™] D10 amplifier for use with fiber optic stroke and leak detection assemblies.




3.2 Calibrating D10 Amplifier for Stroke Detection

When calibrating the D10 Amplifier for stroke detection, the pump should be in the same operating conditions it will be in during normal operation (i.e. supply air pressure, back pressure, etc.). The Fiber Optic must be installed as per the instructions in section 3.1.

Calibration:						
	Push Button	Remote Line	Result			
Access Dynamic TEACH Mode	Press and hold dynamic push button >2 seconds.	Hold Remote line low (to ground) >2 Seconds.	Power LED: OFF Output LED: OFF Bar graph: LO & DO Alternately Flashing			
TEACH Sensing Conditions	 Hold push button. Operate pump normally for 15 seconds. 	Hold remote line low (to ground). Operate pump normally for 15 seconds.	Power LED: OFF Output LED: OFF Bar graph: LO & DO Alternately Flashing			
Return to	▲ · · · ·	Release remote line/switch	Teach Accepted Power LED: ON Bar graph: One LED flashes to show relative contrast (successful setup requires minimum value of 4). Sensor returns to Run Mode with new settings.			
Run Mode			Teach Unaccepted Power LED: OFF Bar graph: #1, 3, 5, 7 alternately flash to show failure to sense. Sensor returns to Run mode without changing settings. Set up again if value shows <4.			

Upon completion of a successful learning cycle, the D10 Amplifier will continuously learn and self-teach to maintain the same cycle rate count readings.

3.3 Single Pressure Switch Stroke Detection Installation

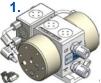

Remove elbow fittings from "M" and "S" ports.



Attach elbow assembly to T adaptor.



Attach T adaptor to "S" port. Reattach elbow fitting to "M" port.



Attach other elbow assembly to pressure switch. Loosen female gripper nuts, and insert air tube between them. Hand tighten gripper nuts.





PSA030 Installation Instructions

3.4 Dual Pressure Switch Stroke Detection Installation

Perform all instructions to both sides of the pump.





Attach T fittings to the "S" ports.

Attach mufflers to the T fittings.

3. Attach elbow assemblies to pressure switches.


4

Loosen female gripper nuts on elbow assemblies and T fittings. Insert tubing and handtighten gripper nuts.



Affix supply air via 1/4 in FNPT QEV ports on both sides. Air supply must be 1/4 in minimum orifice to source.

3.5 Pressure Switch Stroke Detection Electrical Hookups

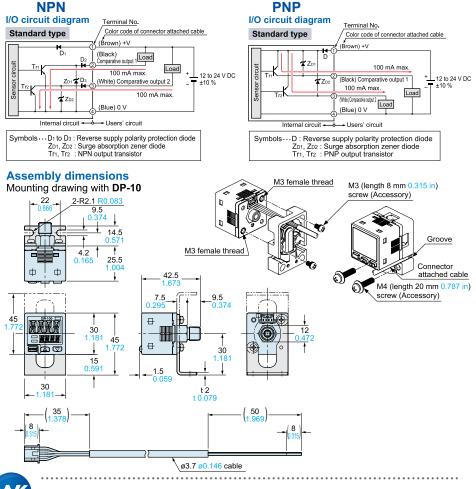

Copyright © 2016 White Knight Fluid Handling | A Graco company P: 435.783.6040 | support@wkfluidhandling.com | https://wkfluidhandling.com



3.6 Fiber Optic Leak Detection Installation

 
Calibrate D10 Amplifier Before Attaching Fiber Optic Probe to Pump (See 3.7)

Perform all instructions to both sides of the pump.




For elbow out configuration, replace steps 2-4 with steps 2.1-2.4 (below).


Remove leak adapter and leak detect probe from fiber optic assembly.




Lower ferrule and gripper until snug against probe and hand tighten female gripper nut.

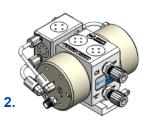

For straight out configuration replace NPT plug in "L" port with the probe. Hand-tighten.

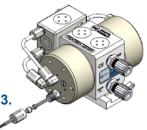

 Insert the fiber optic cable until it contacts the bottom of the probe.




Open the top and slide the front face of the D10 up. Press the fiber optic ends into the holes on its front. Slide the face down to lock cables in place.

For elbow out configuration:



Replace NPT plug in "L" port with the leak adapter.

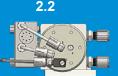

Attach probe to leak adapter and hand-tighten.



Insert fiber optic cable into leak detect probe, ensure it contacts the bottom of the probe.

2.4



Lower ferrule and gripper into the probe. Hand-tighten female gripper nut.

Fiber Optic Sensors

Fiber optic sensors melt if used at >130°C (266°F), resulting in leak or end of stroke detection failure.





3.7 Calibrating D10 Amplifier for Leak Detection

Step 1: Power On D10 Amplifier & Set "Dark Operate" Mode:							
Push Button		Remote Line	Result				
	0.04 s ≤ "Click" ≤ 0.8 s	$0.04 \ s \le T \le 0.8 \ s$					
Access Setup Mode	Press and hold both buttons > 2 seconds.	Double-pulse remote line	 Green Power LED turns OFF. Output LED remains active. Icons continue to display current setup. Bargraph turns OFF. 				
Select Settings	Press either button until LEDs show desired settings.	Pulse the remote line until LEDs show desired settings. T T T T Note: Double- pulsing remote line causes setting to "back up" one step.	Sensor toggles through these setting combinations: LO Normal Speed No Delay (default) DO Normal Speed No Delay LO High Speed No Delay DO High Speed No Delay DO High Speed No Delay DO High Speed Delay LO Normal Speed Delay DO Normal Speed Delay LO High Speed Delay DO High Speed Delay DO High Speed Delay DO High Speed Delay				
Return to Run Mode	Press and hold t both buttons >2 seconds.	Hold remote line low > 2 seconds. > 2 seconds	Green Power LED turns ON. Sensor returns to Run mode with new settings.				

Step 2: Access "Single-Point Dark Set" Mode

	Push Button	Remote Line	Result		
	0.04 s ≤ "Click" ≤ 0.8 s	$0.04 \ s \le T \le 0.8 \ s$			
Access Set Mode	Press and hold static button > 2 seconds.	Single-pulse remote line	Power LED: OFF. Output LED: ON (push button) OFF (remote line) Static LEDs: LO & DO alternately flashing		

Step 3: Set Sensing Condition

Set condition to "leak detection" sensing while probe tip is submerged in liquid. Then, remove the leak probe from liquid and reinserted into the "L" port. Amplifier will now signal when moisture if detected on the probe tip.

	Push Button	Remote Line	Result	
	0.04 s ≤ "Click" ≤ 0.8 s	0.04 s ≤ T ≤ 0.8 s	_	
Condition		Present sensing condition • Five-pulse remote lne	Power LED: ON. Output LED: ON (push button) OFF (remote line) Bargraph: 4 indicators flash. Sensor returns to Run mode with new settin	6 0 0 2 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0
Sat Sancing			Power LED: ON. Output LED: ON (push button) OFF (remote line) Bargraph: #1, 3, 5, 7 flash for failure. Sensor returns to Set sensing condition.	C 0 0 0 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7

